

Troubleshooting VE.Bus network interference

VE.Bus Network Error Count

The network quality counters in the VE.Bus system track the number of frame retransmissions required after a VE.Bus device receives an invalid frame. These counters can be accessed via VRM by adding /diagnostics to the VRM URL for a site. They are reset after you 'reset' the VE.Bus system on the GX device in the Multi Advanced menu.

Key Points on the Counter

The counters operate on the protocol level, not the application level. This means that if a VE.Bus cable connection between two units in a parallel system is removed, the counters in both units will not increment, as the frames are still being sent correctly to all connected devices at the protocol level.

But on the application level, if a Multi in a parallel system is missing, the system will switch off automatically, and a VE.Bus error will be written. However, this event might not reflect in the network quality counters which require a checksum failure (the message is received but it's wrong or corrupt). So the connection has to be good enough that at least some of it is received.

Impact of these errors

Small Systems: In smaller setups with a single unit, delays and retransmissions from a Multi to a GX device may not even have noticeable effects. However, there is a known bug that can cause energy meter counts to stop that will be addressed in a future firmware update.

Large Systems: In larger configurations with numerous VE.Bus devices, the impact of errors grows exponentially, potentially leading to "Error 3 - Not all, or more than, the expected devices were found in the system." And alike. Current is also higher, so more interference is created, so more attention is required.

Normal Counter Levels

They accrue over time, so it's hard to pin down. It's an indicator. A high network error count is often correlated with other issues, but not always, and a high count is not a fault unto itself unless it presents with other issues. Post-commissioning and VE.bus system reset, a count should be 0.

Rather than there being some objective number that is acceptable or not, treat it as a diagnostic on a per system basis. Check the counter, if it's a new system and it's more than 10, there is a problem. Make the changes you can to reduce interference, reset the counter, and then use it to help see if you were successful without waiting for a system shutdown.

Note if there is variation in the counter levels between units then focus your attention on those with higher numbers, it might indicate where the interference or issue is coming from within the physical installation.

Addressing Interference

Use Manufactured Cables! Always use manufactured cables rather than crimping them onsite. A lot happens at the point of contact. Attempting to crimp cables on site will increase the odds of these issues. The amount of noise to signal goes up dramatically on a less than perfect crimp that visually looks fine and tests ok for continuity.

Separation and Cable Management: The intensity of interference from power cables follows an inverse square law. Maintaining separation is important, and bundling power and comms cables together should always be avoided.

If you have VE.Bus errors, and they aren't corrected by simply replacing the communications cables, then they likely need to also be re-routed. Even temporary (though still secure) re-routings can help to rule out this as a cause of issues before escalating to the replacement of hardware (such as the GX device or Inverters).

Interference Intensity at Various Distances

- At 1 cm (data cables side by side with power cables), the relative interference intensity is 100%.
- At 2 cm, the intensity reduces to 25%.
- At 3 cm, it further drops to approximately 11.11%.
- At 10 cm, the interference is only 1% of what it is at 1 cm.
- At 20 cm, the interference falls to 0.25% (from then on can usually be assumed safe)
- At 100 cm, the intensity is a mere 0.01% (99.9% reduction, but usually impractical)

Length of Run: The longer the run of the cables, especially when in parallel with power cables, the worse the effect, necessitating greater separation. Also the longer the communications cables run generally the weaker the signal and the greater the noise. So minimise the lengths where possible and avoid bundling or coiling excess. Use a shorter manufactured cable if possible.

Type of Current: DC solar cables are the most likely to cause interference. AC cables are more likely to cause interference than DC battery cables. Other data communications cables will rarely cause interference.

Ferrite core cable clips

The use of Ferrite core noise suppressing cable clips can also help filter out noise. These are a widely available part and available very cheaply. Some Ferrite core clips are supplied with GX devices and should be attached to the GX power supply cables with a loop to reduce in-line noise and interference.

From:
<https://www.victronenergy.com/live/> - **Victron Energy**

Permanent link:
https://www.victronenergy.com/live/ve.bus:ve.bus_network_interference?rev=1707179324

Last update: **2024-02-06 01:28**

