

Victron & ZYC Energy



1. Product & System compatibility

1.1 A GX device is required, eg Cerbo GX, etc

It is essential to use the BMS-Can (or CAN-bus) connection of a [GX device](#) with these batteries for communication of charge and discharge limits, error codes and state of charge. This is set to 500 kbit/s.

It is recommended to use the latest firmware version on new installations and when trouble shooting issues.

1.2 All 48V Multis, MultiPlus, Quattros and RS models are compatible

The minimum supported firmware version for VE.Bus models is 469. Minimum supported firmware for RS models is 1.16. Updating to the latest firmware is recommended for new installations, and troubleshooting issues.

These inverter/charger units must be connected to the [GX device](#) via the VE.Bus connection port.

In grid connected systems, advanced control functions are configurable in the ESS settings on the [GX device](#).

In off-grid systems, the control functions of the Battery Management System (BMS) are built into the latest version of the [GX device](#).

1.3 Solar Charger compatibility

All 48V BlueSolar and SmartSolar MPPT Chargers are compatible.

Some of our Solar Chargers feature a VE.Direct communication port, some feature a VE.Can communication port, and some feature both. Both of these types of communication ports can be used to connect the Solar charger to the GX Device. Such connection is mandatory, because it is used to regulate charge currents and voltages.

When planning to use the VE.Can communications port to connect the Solar Charger(s), make sure to select a GX Device that has sufficient CAN-Bus ports. The Color Control GX has only one such port, its VE.Can port, and is therefore not suitable. All other GX Devices can be used, since they have two ports. One can then be used to connect the battery, and the other to connect the Solar Charger.

2. Minimum battery sizing

Inverter/Charger	Single Phase	Single Phase	Three Phase	Three Phase
	On-grid	Off-grid	On-grid	Off-grid
Multiplus 48/500/6	1	1	1	1
Multiplus 48/800/9	1	1	1	1
Multiplus 48/1200/13	1	1	1	1
Multiplus 48/1600/20	1	1	1	2
Multiplus 48/2000/25	1	1	1	2
Multiplus 48/2000/25-50 120V	1	1	1	2
Multiplus 48/3000/35	1	1	2	3
Multiplus 48/5000/70	1	2	2	4
Multiplus II (GX) 48/3000/35-32	1	1	1	3
Multiplus II (GX) 48/5000/70-50	1	2	2	4
Multiplus II 120V 48/3000/35-50	1	2	1	3
Multiplus II 120V 48/5000/70-95	1	2	2	4
Multiplus II 48/3000/35-32	1	1	1	3
Multiplus II 48/5000/70-50	1	2	2	4
Multiplus II 48/8000/110-100	1	3	3	7
Multiplus II 48/10000/140-100	2	3	3	8
Multiplus II 48/15000/200-100	2	4	4	12
Quattro 48/3000/35-50/50 120V	1	1	2	3
Quattro 48/5000/70-100/100 120V	1	2	2	4
Quattro 48/10000/140-100/100 120V	2	3	3	8
Quattro 48/5000/70-100/100	1	2	2	4
Quattro 48/8000/110-100/100	1	3	2	7
Quattro 48/10000/140-100/100	2	3	4	8
Quattro 48/15000/200-100/100	2	4	4	12
Quattro 48/15000/200-100/100 277V	2	4	4	12
Quattro II 48/5000/70-50	1	2	2	4
RS Smart Solar 48/6000	1	2	2	4
Multi RS Solar 48/6000	1	2	2	4
Multi RS Solar 48/6000 Dual Tracker	1	2	2	4
Easysolar II 48/3000/35-32 MPPT 250/70 GX	1	1	2	3
Easysolar II 48/5000/70-50 MPPT 250/100 GX	1	2	2	4

3. Further system integration documentation

A [QuickStart guide with further details about installation and configuration is available from ZYC Energy here.](#)

[Their product manual contains further information here.](#)

3. Installation Video



Video

4. Remote ZYC firmware update via VRM

VRM remote firmware update is typically only for Victron products, however a special ZYC integration allows for this specific third-party battery update via the GX device and VRM without requiring any extra tools or software.

Prerequisites

Before starting, ensure the ZYC battery is connected to a Victron GX device via CAN-Bus and that the GX device is internet-connected and registered with the Victron VRM portal. You'll also need the necessary permissions in VRM to perform updates.

Confirm the GX device is internet-connected with “Full access” enabled in the VRM menu of the GX settings.

Updating Process

Access the Victron VRM portal, select your installation, and check the device list for the ZYC battery to make sure it is properly detected.

Firmware update for ZYC Energy

Rescan

You can use this page to update the firmware of devices connected to your GX device. For detailed instructions about the update process visit: [Remote Firmware Update Manual](#).


Device description	Product Id	Serial Number	Installed	Latest	Updatable	
BlueSolar Charger MPPT 150/60 rev2	A070	HQ2215E6YVJ	v3.07	v3.16	<button>Update Device</button>	
Color Control GX	C001	Unknown	v3.41	v3.50-31	<button>Update Device</button>	
MultiPlus-II 48/5000/70-48	2623	Unknown	v498	v552	<button>Update Device</button>	<button>Upload file</button>
ZYC battery	B01A	ZD011M20A024012400059	v2.8.0	N/A	Product not in library	

Check for Updates

Victron does not store ZYC firmware files on VRM, nor does it know what the latest firmware version is, or if there is an update available. ZYC updates will need to be downloaded to your computer first from <https://www.zycportal.com> documentation section so that you can upload them via VRM.

The screenshot shows the ZYC Portal homepage with the following data:

- Country:** China
- System Status:** 1 Online, 0 Offline, 1 Offline
- Tickets:** 3 Confirmed, 2 Pending Approval
- Timeline:** 2025-02-01 to 2025-02-03
- Documents:** A list of files including ZYC Tools, ZYC Firmware, ZYC Assist Pro, and other documentation. This section is highlighted with a red box.
- FAQ:** A list of topics including SIMPO5000 Installation, Product Features, and Tech Service Question.

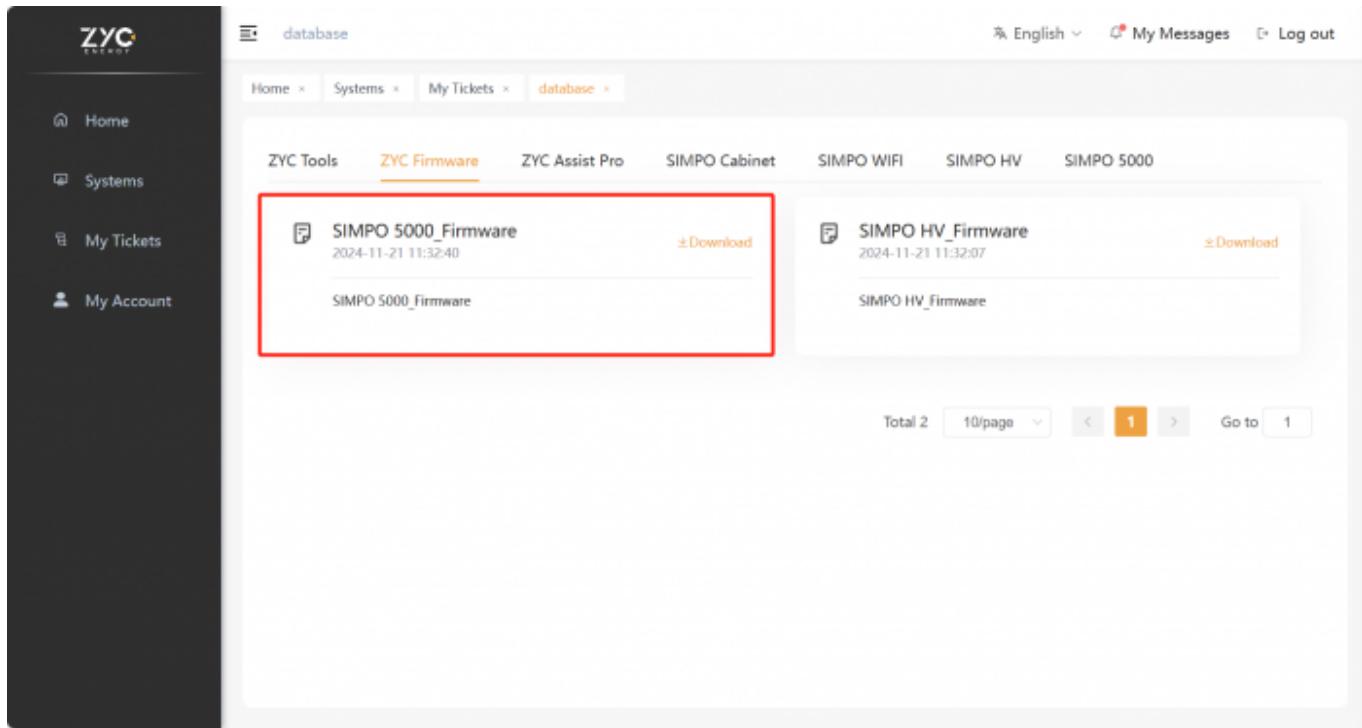

The screenshot shows a web-based interface for managing device firmware. The left sidebar has links for Home, Systems, My Tickets, and My Account. The main content area has tabs for ZYC Tools, ZYC Firmware (which is selected and highlighted in orange), ZYC Assist Pro, SIMPO Cabinet, SIMPO WIFI, SIMPO HV, and SIMPO 5000. The ZYC Firmware tab displays a list of available firmware updates. The first item in the list is 'SIMPO 5000_Firmware' from 2024-11-21 11:32:40, with a 'Download' button. Below it is 'SIMPO 5000_Firmware'. Further down the list are 'SIMPO HV_Firmware' from 2024-11-21 11:32:07 and 'SIMPO HV_Firmware'. At the bottom of the list, there are pagination controls showing 'Total 2', '10/page', and a page number '1'.

Prepare for Update

Review any notes or warnings in VRM, ensuring the system is in a safe state for updating.

While this is a reliable procedure, there are always risks involved when performing a firmware update. For example in a remote off grid system, if a power outage would affect someone on site they should be notified first before attempting it.

Perform the Update

Open the device list for the site, click the Firmware update button. If there is no firmware update button; [see here for troubleshooting](#).

Follow VRM's on-screen instructions to initiate the firmware update, this involves uploading a firmware file obtained from [ZYCs website](#). Wait for the process to complete.

If the update fails, restart GX device, retry the update, and if it fails again, contact ZYC for support.

Verify the Update

After completion, check the battery's firmware version in VRM and monitor for any system issues. The VRM firmware update is applied to the Master battery, for large systems it can take some time for the ZYC BMS to then automatically update the firmware of the other connected batteries.

[ZYC has prepared a step by step guide here -](#)

[simpo_5000_update_guide_via_vrm_v1.0.pdf](#)

There is a screen recording of the process here -

[update_firmware_through_vrm.mp4](#)

5. Support

Support for this battery should first come from your ZYC Energy supplier.

Support from Victron is limited to our online [Victron Community](#) page.

From:

<https://www.victronenergy.com/live/> - **Victron Energy**



Permanent link:

https://www.victronenergy.com/live/battery_compatibility:zyc_energy?rev=1741139228

Last update: **2025-03-05 02:47**